Duo Photometer DP 200 Operating Manual Version 5.4 / 5.7 SI Edition 2021-01 Dear customer,

We are pleased that you have chosen the Duo Photometer from Diaglobal GmbH and thank you for the confidence you have placed in us.

The Duo Photometer belongs to a new generation of small mobile devices developed by Diaglobal GmbH and specially designed for on-site analysis.

With the software version V5.3 and higher, an automatic test of the device function has also been integrated. Therefore, the Duo Photometer complies with the requirements of the guidelines of the German Medical Association.

With the Duo Photometer, 3 clinical-chemical parameters can be determined. The device can be supplied with SI units of measurement on request (see chapter 9, Technical Data, table Measuring Ranges).

The kits and accessories required for the test are also available from Diaglobal GmbH.

All the best for your work with the new Duo Photometer!

Yours Diaglobal GmbH

Table of contents

1.	General information regarding the Photometer	4
2.	Installation	5
3. 3.1 3.1.1 3.1.2 3.2	Description of the device Power supply Mains power operation Mains-independent operation Measuring system	5 6 6 6
4. 1 4.2 4.3 4.4 4.5	Service Adjustment and Calibration Maintenance Cleaning Instructions Malfunctions Disposal	7 7 7 7 7 7
5. 1 5.2 5.3 5.4	Required reagents and laboratory accessories Expiration date of consumables Reagents / parameter list Control materials Laboratory aids	8 8 8 8
6.	Quality control according to the Guideline of the German Medical Association	9
7.	Measuring procedure End-point measurement	9 9
8. 8.1 8.2 8.3 8.4 8.5 8.6	Measurement Switching the device on Self-test when switching on Test selection Switching the device off Integrated operational device checks Notes on taking samples and carrying out measurements	10 10 10 10 10 10 11
9.	Technical data	13
10.	General guidelines and notes	14
11.	Appendix: "Step-by-step measurement"	14ff.

Page

1. General information on the Photometer

Device name:	Duo Photometer
Model:	DP 200
Features:	In-vitro diagnostics, measuring device for the determination of selected clinical-chemical parameters in blood

The Duo Photometer fulfils the basic requirements of Appendix I of Directive 98/79/EC regarding in-vitro diagnostics.

The conformity of the device with Directive 98/79/EC is confirmed by the use of the CE marking.

Manufacturer: Diaglobal GmbH Innovationspark Wuhlheide Köpenicker Str. 325 / Haus 41 12555 Berlin

> Tel: +49 (0) 30 6576 2597 Fax: +49 (0) 30 6576 2517 E-Mail: info@diaglobal.de

http://www.diaglobal.de

2. Installation

For trouble-free operation of the device, the following environmental conditions must be met:

- Ambient temperature: 0 °C ... 40 °C
- No direct exposure to sunlight or similar sources of radiant heat
- Free from excessive dust
- Free from vibrations
- Free from interference by electromagnetic waves
- Operation on a horizontal surface

Please observe the following instructions for use:

Insert a rechargeable battery or normal battery if the device is to be operated independently of a power supply or connect the photometer to a power supply unit.

Press the **<ON/ENTER>** key (Fig. 1) to activate the internal device check which is automatically carried out by the device.

The device is then immediately ready for measurement.

3. Description of the device



Fig. 1

3.1 Power supply

The Duo Photometer can be operated as desired using a power supply, a (9V block) battery or (model 6F22 or PP3) rechargeable battery.

3.1.1 Mains power operation

The Photometer is supplied with a power supply unit for operation on a mains voltage in the range of 100 V \dots 240 V AC. The mains plug is marked with a Diaglobal logo (sticker).

The connector plug of the power supply unit is connected to the power supply socket on the back of the device.

3.1.2 Network-independent operation

To insert the rechargeable battery or the normal battery:

Unscrew the knurled screws on the bottom of the unit and remove the battery compartment cover. Connect the battery to the push-button contact and insert it into the device. Replace the battery compartment cover and screw in the knurled screws.

Please note:

The Duo Photometer can be operated using a power supply without the need to remove the rechargeable battery or the normal battery.

The rechargeable battery cannot be charged while it is installed. A separate battery charger is required for this purpose.

3.2 Measuring system

The optical section is shown in Fig. 2.

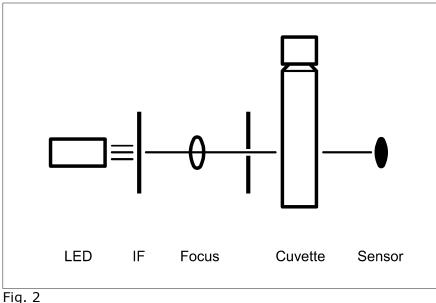


Fig. 2

The light emitted by an LED is first selected into its wavelength range (546 nm) by an interference filter IF (HBW \sim 5 nm) and then bundled and directed onto the cuvette in the shaft. After passing through the cuvette, a broadband photosensor converts the light falling on its sensor surface into a current, proportional to the intensity.

4. Service

4.1 Adjustment and Calibration

The instrument is adjusted and calibrated at the factory on delivery, adjustment by the customer is not necessary.

Adjustment is carried out via the interface socket on the rear panel. It can only be carried out at the factory, adjustments by the customer are not possible.

Information on calibrating the device can be found in chapter 6. *Quality control according to the Guideline of the German Medical Association*.

4.2 Maintenance

The device is maintenance-free. Maintenance after the warranty period is recommended, but not mandatory.

Due to the integrated test of the unit functions (chapter 8.5) and regular tests with control material, maintenance is only recommended if one of these two test functions indicates an error message.

4.3 Cleaning Instructions

Commercially available decontaminating solutions commonly used in clinical chemistry laboratories, such as Mikrozid® AF Liquid, Bacillol® plus, 3 % Kohrsolin® or similar, are recommended for cleaning the device and the surface. Before cleaning the unit with a soft cloth and the decontaminating solution, it must be switched off and the electrical power supply must be disconnected.

Make sure that no liquids get into the device. There is no protection against penetrating liquids (Code IP X0).

The cuvette shaft must not be cleaned by the user of the device, as this may damage the device. If cleaning is necessary, especially because of leaking liquids or broken glass, please contact Diaglobal GmbH.

4.4 Malfunctions

If any malfunctions or problems occur, simply call us. Most questions can be answered on the phone. Non-functional units should be sent to our Berlin address. We will provide a loan device for the duration of the repair.

4.5 Disposal

Diaglobal GmbH will take back and dispose of units that are no longer needed or cannot be repaired, free of charge.

5. Required reagents and laboratory accessories

5.1 Expiration date of consumables

It is important to ensure that all consumables may only be used within the expiration date.

5.2 Reagents / parameter list

The following tests can be measured with the Duo Photometer:

Parameter	Sar	nple mate	rial	Tests/pack	Art no
ralameter	Blood	Serum	Plasma	Tests/pack	AIL IIU.
Haemoglobin (HiCN-method)	+	-	-	40	HB 142
Haemoglobin (SLS-method)	+	-	-	40	HB 342
Erythrocytes	+	-	-	40	ERY 142
Haematocrit	+	-	-	40	HCT 142

5.3 Control materials

Art. no.	Description	Contents
HEM QS	Haemoglobin control Haemolysate for correctness and precision control of haemoglobin determination in blood in the normal range	5 x 1 mL
ERY QS	Erythrocytes- and Haematocrit control Control blood for accuracy and precision control of haematocrit and erythrocytes determination in blood in the normal range	5 x 1 mL

5.4 Laboratory aids

Art. no.	Description	Contents
LH 001	Blood lancets	500
LH 004	Capillaries 10 μ L, with ringmark	250
LH 006	Cuvette rack	1
LH 007	Micropipettor (pipetting aid)	1
LH 009	Cellulose swabs	500
LH 010	Cellulose swab box	1
LH 011	Alcohol pads, non-steril	100
LH 012	Powder-free nitrile gloves size M	200
LH 035	Safety Lancets Extra, orange 1.8 mm	200

All reagent kits, control materials and other materials are supplied by Diaglobal GmbH and can be stored and transported together with the Duo Photometer in a practical case.

6. Quality control according to the Guideline of the German Medical Association¹⁾

The Duo Photometer has been specially developed for near-patient immediate diagnostics with unit-use reagents (German Medical Association, part B, chapter 2.1.5). According to the guideline of the German Medical Association, there is therefore no obligation to participate in surveys (German Medical Association, part B, chapter 2.2, paragraph (3) a). The user only has to carry out internal quality checks.

Internal quality assurance is carried out in the form of a weekly accuracy check (calibration) with subsequent documentation of the measured value. The corresponding protocol forms are available from Diaglobal free of charge.

We recommend using the blood control HEM QS and ERY QS with target values in the normal concentration area for checking the accuracy of determinations of haemoglobin, haematocrit and erythrocyte counts.

In agreement with the requirements of the German Medical Association, a test of the device function (see operating instructions, chapter 8.5) is integrated in the Duo Photometer, therefor a daily test by means of a standard manual test (German Medical Association, part B, chapter 2.1.5, paragraph (2) is not necessary.

7. Measuring process

7.1 Endpoint measurement

The absorbance is measured after reaching the endpoint. It is measured against the reagent's blank count.

Parameters: Haemoglobin SLS (HB SLS), Erythrocytes (ERY), Haematocrit (HCT), Haemoglobin (HiCN)

Calculation: Concentration = Absorbance x Factor

The erythrocyte and haematocrit counts are determined using stored reference curves.

¹⁾ Guideline of the German Medical Association for the quality assurance of laboratory medical examinations Deutsches Ärzteblatt | Jg. 116 | Heft 51-52 | 23. Dezember 2019

8.1 Switching the device on

Press the **<ON/ENTER>** key.

8.2 Self-test when switching on

When the device is switched on, a self-test of the digital and analogue circuitry is conducted. The operational device check proceeds automatically after it is switched on. It takes approx. 5 seconds, after which the unit is ready for measuring

Note:

If it becomes obvious during the test that one of the device functions does not correspond to the required settings, <SERVICE> will appear in the display.

In this case, switch the device off.

Please call Diaglobal GmbH service (Tel. +49 (0) 30 6576 2597) or contact your specialist retailer.

8.3 Test selection

Press the **<ON/ENTER>** key.

The desired test is selected from the menu with the right or left arrow key:

HB-SLS - ERY - HCT - HB - ABS546

Pressing the right arrow key activates the next test while pressing the left arrow key returns to the previous test. The selected test is shown in the upper right corner of the display.

Confirm test selection with the **<ON/ENTER>** key.

8.4 Switching the device off

To switch the device off, press both arrow keys simultaneously.

8.5 Integrated operational device checks

Self-test when switching on

Testing of the digital and analogue circuits of the device is automatically performed by the device when it is switched on. Please see chapter 8, point 8.2.

Differential measurements

All measurements are based on differential measurements. I. e. after selecting the desired test, the device requests a zero measurement with a blank value cuvette. This creates a reference base to the measured value so that minor deviations can be compensated.

Measurement range controls

The measurement ranges of all measurement results shown in the display are verified by an integrated measurement range control. If the measurement range is exceeded, an error is displayed.

The measurement ranges that are separately defined for each parameter are documented on the respective package inserts as well as in this operating manual, chapter 9, Technical Data.

Plausibility controls

For multi-point measurements, the absorbance measured first forms the reference basis. The programme verifies the plausibility of the individual measured values. If specific requirements (e.g. E2 > E1 for ascending reactions) are not met, an error message is displayed.

8.6 Notes on taking samples and carrying out measurements

Errors in taking samples will always lead to incorrect measurement results. This chapter addresses the most common errors that can occur during taking samples and measuring samples.

- 1. Never touch the lower part of the cuvette (where the liquid is) with bare hands. If this should happen accidentally, clean the vials with a fluff-free cloth before use. Cleaning with a fluff-free cloth is recommended in any case. Even if the package is still new and unopened. Fingerprints on the cuvette lead to incorrect measurement results.
- 2. If blood is taken from the fingertip or earlobe, note that the first drop that forms spontaneously must be wiped away with a cellulose swab. It contains a high proportion of tissue fluid, which will corrupt the measurement result.
- 3. The second drop that forms is for blood sampling. To support blood collection, it may be pressed carefully (!). The emphasis on carefully, otherwise too much tissue fluid will get into the blood sample again.
- 4. Make sure that the blood drop that forms is large enough to fill the capillary with the required sample volume in one go. Repeated filling of the capillary leads to air bubbles that cannot be removed from the capillary. If air bubbles form, discard the capillary and start sampling again.
- 5. The capillary must be filled exactly up to the black ring mark.

Please note: A deviation of only 1 mm from the ring mark is sufficient to obtain a completely incorrect measurement result!

If the sample is above the black ring mark, this will lead to incorrect positive measurement results. A cellulose swab can be used to carefully soak up too much blood.

If the sample is below the black ring mark, this will lead to incorrect negative measurement results. In this case, correction is hardly possible due to the air bubble that will form when trying to collect more blood.

- 6. Before the capillary is placed in the cuvette, the lower area must be carefully wiped on the outside with a cellulose swab to remove sample particles attached to the capillary. Otherwise, this would lead to incorrect positive measurement results.
- 7. With the help of the micropipetter, the sample is completely transferred into the cuvette. The complete transfer of the sample is done by ejecting it several times with the help of the push button on the micropipetter.

Please note: The micropipetter is only used when the capillary is filled with the sample. It is not needed for filling the capillary. The capillary is filled by the capillary action alone.

9. Technical data

Storage temperature:	-20 °C 70 °C
Operating temperature:	0 °C 40 °C
Dimensions:	200 x 100 x 50 mm
Weight:	450 g
Measuring principle:	Absorption measurement with single beam photometer (Fig. 2), chopped operation
Projector:	LED
Spectral apparatus:	Interference filter
Measuring wavelengths:	546 nm
Spectral half-width value:	~ 5 nm
External light influence:	Negligible
Interface:	V24 (9600, 8, n, 2)
Power supply:	6 V 12 V DC
Current consumption:	max. 250 mA
Warm-up time:	0 min
Interference suppression:	According to DIN VDE 0871 and DIN VDE 0875
Inaccuracy:	< 0.5 % at A = 1.000
Relative photometric short-time standard deviation:	< 0.1 %

Measuring ranges:	<u>DP 200</u>	<u>DP 200 SI</u>
Haemoglobin (HiCN-method)	0.0 - 50 g/dL	0.0 - 31 mmol/L
Haemoglobin (SLS-method)	0.0 - 50 g/dL	0.0 - 31 mmol/L
Erythrocytes	1.0 - 10 Mio/µL	1.0 - 10 Mio/µL
Haematocrit	5 - 90 %	5 - 90 %
ABS 546nm	A = 2.500	A = 2.500

EC Directives

1. Directive 98/79/EC on in-vitro diagnostic devices

EN / ISO standards

- EN ISO 9001:1994, Quality Management Systems, Model for quality assurance in design, development, production, installation and customer service
- **3.** EN ISO 13485, Medical devices, Requirements for regulatory purposes (application of EN ISO 9001)
- **4.** EN ISO 14971, Medical devices Application of risk management to medical devices
- **5.** EN 61010 -1, Safety requirements for electrical equipment for measurement, control and laboratory use Part 1: General requirements
- **6.** EN 61010 -2-101, Safety requirements for electrical equipment for measurement, control and laboratory use Part 2-101: Particular requirements for in-vitro diagnostic (IVD) medical equipment
- **7.** EN 61326 -1, Electrical equipment for measurement, control and laboratory use EMC requirements Part 1: General requirements
- 8. EN 61326 -2-6, Electrical equipment for measurement, control and laboratory use - EMC requirements - Part 2-6: Particular requirements – In-vitro diagnostic (IVD) medical equipment
- **9.** EN 592, Instructions for use for in-vitro diagnostic instruments for professional use

National directives and recommendations (Germany)

10. Guidelines for Quality Assurance of Laboratory Examinations of the German Medical Association of 23.12.2019

Note on electromagnetic compatibility

- a) The photometer meets the requirements for electromagnetic radiation and interference immunity as described in the IEC 61326 series of standards.
- b) Do not use this device near sources of intense electromagnetic radiation because they may interfere with correct functioning. A distance of at least 1 m should be maintained between an operational (switched on) mobile phone and the photometer during measurement.

Note on the unit's internal quality control

The functionality of the device is checked when it is switched on. In addition, electronically controlled checks are carried out for individual tests during the measurement, which leads to an error message if specified requirements are not met.

11. Appendix: "Step-by-step measurement"

Please refer to the illustrations in the "Step by step" instruction manual.

Step by step instructions

Device manual






1. Switch on: Press ON/ENTER key Wait for device check and confirm with ON/ENTER



2. Select test: Press arrow key until required test appears




3. Confirm required test: Press ON/ENTER

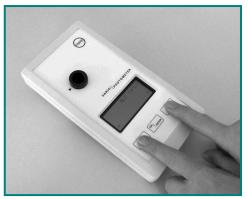

4. Switch off: Press both arrow keys at the same time

Note: If SERVICE appears in the display after the device check, the device has a defect. In this case, please contact our customer service at +49 (0) 30 6576 2597.

Step by step instructions







1. Insert capillary with 10 μ L blood sample into cuvette




2. Eject blood several times with micropipetter into cuvette



3. Screw cap onTurn cuvette upside down several timesWait 3 minutesHB 342: wait 30 seconds

	HB-SLS
Insert blank	
\leftarrow	$\left. \stackrel{\text{ON}}{\left. \right _{\text{enter}}} \right \longrightarrow$

4. Switch photometer on with ON/ENTER key Wait for device check, confirm with ON/ENTER Select the required test, confirm with ON/ENTER

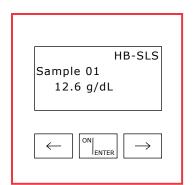

7. Insert cuvette with blood sample (Fig. 3) into photometer Read measured value

Zero HB-SLS 0	[
0	Zero	HB-SLS
		0

5. Zero point adjustment: Insert an unprocessed cuvette from package into photometer Zero point is stored in memory



In regard to series measurement: After zero point setting any number of additional samples can be measured

HB-SLS
Sample 01 insert
Insert

6. Remove cuvette after signal tone